

Date of Issue: 10th July 2023

**Re: PRODUCT SAFETY ALERT:
Honeywell MILLER Flame Retardant Adjustable Energy Absorbing Lanyards**

Bullivants is contacting your company as we have received recent advice of a quality matter from Honeywell, our supplier of MILLER Flame Retardant Adjustable Energy Absorbing Lanyards.

Bullivants Part Number	Description
WLN-200-C3C3-K-L-EC	2M KEVLAR LANYARD WITH 91326 TAKS - L28KEC2.0
WLN-200-D1D1-K-M-EC	2M KEVLAR SINGLE LANYARD W/19MM HOOKS - L11KEC2.0
WLND-200-C3L9-K-M-EC	2M DOUBLE KEVLAR WEB LANYARD TAK & SCAFF - M1010119
WLN-200-D1D1-K-M-ECA	2M KEVLAR ADJUSTABLE LANYARD W/19MM HOOK - LA11KEC2.0
WLND-200-2D1D1-K-M-EC	2M KEVLAR TWIN LANYARD W/19MM HOOKS - LD11KEC2.0

Quality Matter:

While there have been no reported incidents due to this safety issue, Honeywell Personal Protective Equipment has issued this Product Market Action Notice as stitching may be missing at the shock absorbing pack, improper use of the product in the affected part numbers may result in serious injury or death. Honeywell have advised a non-destructive inspection method to check on the stitches. Please see below.

Impacted units were sold between 2018 – 2023.

Example Photos:



WLN-200-D1D1-K-M-EC



WLND-200-2D1D1-K-M-EC



WLN-200-D1D1-K-M-ECA

Action for customers:


The following information provides detailed instructions on immediate actions you are required to take:

- These products must be immediately separated from work area/field/stock.
- These products must be checked before use as per the Instruction below:

Inspection instruction:

1. By using a pen or a small cylindrical rod, insert into the shock absorber protective pack. Please do not use any item that has sharp or pointing edges, to prevent damage to the shock absorber (Picture 1 and Picture 2)
2. Create a cavity and remove the pen or cylindrical rod, check if there is presence of stitching inside the absorber (Flashlight would be helpful if the surrounding is dark) (Picture 3)
3. If found that the stitching is missing at the shock absorbing pack, please notify Honeywell to initiate RMA process. RMA will be issued once the affected product (with missing stitching) is returned to Honeywell.

Action for customers (continued)

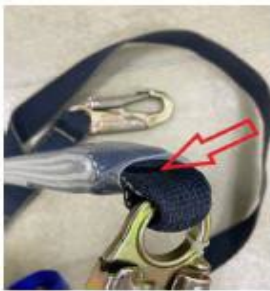

Picture 1



Picture 2



Picture 3

For questions, please contact Honeywell:

Whole of Australia: +61 1300 139 166 HLSHSPAMelbourne@Honeywell.com.

Western Australia: +61 89 337 6980 HLSHSPAPerth@Honeywell.com

or Ricky Gleis at his email: Ricky.Gleis@honeywell.com

Please provide your acknowledgment of receiving this notification to your local Bullivants Branch within 4 weeks

Please contact your local Bullivants Branch if you have any questions about this product safety alert or if you would like to discuss the process for returning the Honeywell MILLER Flame Retardant Adjustable Energy Absorbing Lanyards for a full refund or a free-of-charge replacement.

Sincerley,

Christopher Singleton | **National Quality & Compliance Manager, Ethical Sourcing Manager**



NATA Authorised Representative

E: christopher.singleton@bullivants.com

This email comes to you from Bunurong Country.

www.bullivants.com